38. Fitted serviceable ignition lead shielding right magneto.
39. Reinstalled No. 2 cylinder, piston and ring assembly, with new cylinder.flange oil seal.
40. Torqued cylinder held down muts to 300° lbs.
41. Fitted new pal. mut on cylinder held down studs.
42. Installed intake pipe with seals No. 2 cylinder.
43. Fitted new oil seals in exhaust and intake push red cover tubes; No. 2 cylinder.

No. 2 cylinder.

44. Adjusted intake and exhaust tappets and installed rocker bex covers No. 2 cylinder.

Replacement Parts Fitted

cer.	Part No.	Description
1 2 3 1 4 1	23996	Packing
	24934	Packing
	15772	Packing
•	802	Packing
7	59417	Bushing
•	40346	Gasket
+	32909	Gasket
4 2	14096	Packing
	40345	Packing .
*	88917	Packing
	86583	Look
•	AN5008450-A	Cone
•	820	Gaskets
28	31255	Rose
84	88962	Gasket
2	AN365-428	Fiber Stop Nuts
2	31724	Oil Seal
•	20515	Gasket
•	5558	Canket
î	32358	Gasket
•	14438 90764	Oil Seal (ring)
í		Packing
1	14438	Oil Seal
7	88917 140 96	Packing
11191441	802	Seal
36	7635	Seal
14	7035	Pal. nuts
4		Ferrules
		Piston & Ring Assembly.

ereby certify that all work listed has been done with certified material according to accepted practice; that all Manufacturer's Service Bulletins affecting safety have been complied with the disserting unapproved modification has been incorporated and that the aircraft is nighter thysound in accordance with accepted and the practice.

Signed.