


## LAW'S PATENT COMBINED SHINGLE AND HEADING MACHINE.

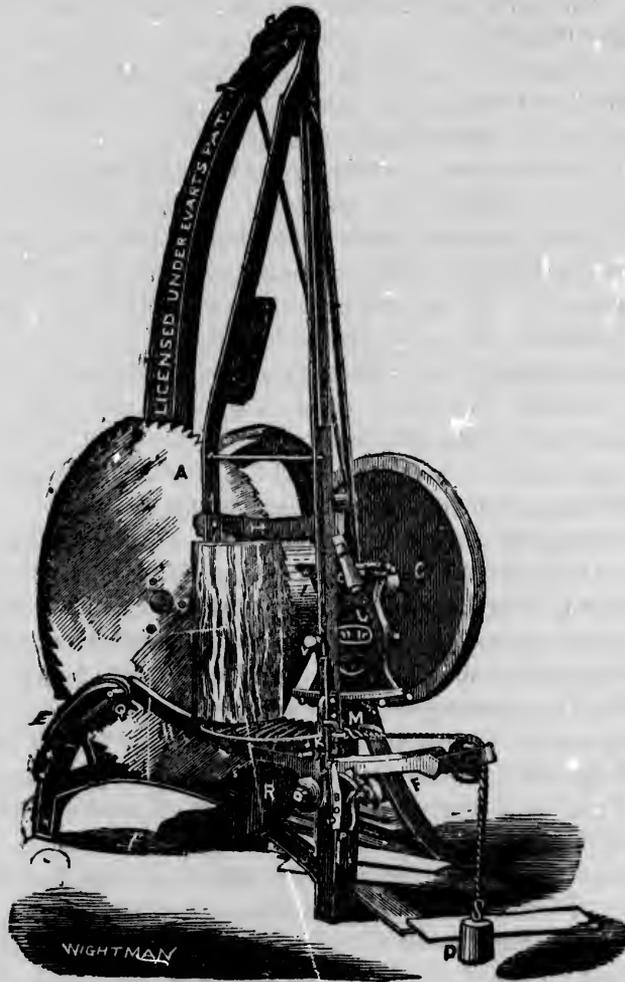

[FIG. 2.]

IN SETTING UP OBSERVE THE FOLLOWING

### DIRECTIONS AND GENERAL REMARKS.

A few simple directions, if carefully followed, will enable almost any one to set up and run the Law machine successfully.

Having prepared a substantial platform, of the shape of the letter L, 10 or 12 inches high, place the frame upon it so that all the feet will bear and the Shingles or Heading fall to the floor without striking the platform. The platform must be large enough for the operator to stand upon it. In case the machine is set up so it is convenient to allow the Heading or Shingles to fall through the floor to the lower story, then this platform is not needed. Put the slide (F) and arm (E)—Fig. 2—in place, and connect them by means of the small nut on the end of the screw (Q). Do not move the large lock nut on the screw (Q). Then place the piece (Y) on the top of